



**TURN ALL POWER OFF BEFORE STARTING INSTALLATION.**

Route all SoftStart wires into the electrical box. Then crimp Connectors onto all SoftStart wires as indicated in drawing.

- Step ① Follow White Compressor wire from Compressor to Run Capacitor "C" terminal. Disconnect from "C" terminal and connect it to Green SoftStart wire. Tape connection with electrical tape.
  - Step ② Connect Black SoftStart wire to the terminal that the White Compressor wire was on.
  - Step ③ Connect Yellow SoftStart wire on terminal next to Red Compressor wire on HERM terminal of Run Capacitor.
  - Step ④ **IF** there is a second Red wire next to the Red Compressor wire, disconnect it, seal end with tape and drop it.
  - Step ⑤ Follow Black Compressor wire to Terminal Block. Disconnect it and connect to Blue SoftStart wire. Tape connection.
  - Step ⑥ Connect Red SoftStart wire onto the terminal that the Black Compressor wire was on.
- Secure all wires. Tape connections with electrical tape.

Turn Power and A/C Breaker on. Turn A/C to Auto Cool setting and set the thermostat to 55°F.

Look at SoftStart LED lights. Green light should be "on". Green light means the Compressor is running (there may be a full 3-minute delay before Green light comes on). **IF there is no Green light after 4 minutes**, please check the error code or contact us for assistance.

After establishing Green light operation, re-install all A/C covers.

Turn A/C on, set near to outdoor temperature and run for 30 minutes.

After 30 minutes, operate A/C normally.

Wiring Diagram for GE AC ARC 13AAC, AHC, 15AAC

Copyright © EDWODER LLC. All Rights Reserved.